

Assure Before You Buy!
Protect Yourself from Hidden Risks!

CarAssure.com.au



Volkswagen Caravelle Wagon

VIN# WV2ZZZ7HZ5H093760 Date/time of Inspection: 27/09/25 2:20 PM
REG# 815FT7 State: QLD

Vehicle information

-  Brand: Volkswagen


 Year of manufacture: 2005

 Transmission: Automatic

 Odometer Reading: 258,664

 Engine capacity: 2.5
-  Model: Caravelle

 Colour: white

 Fuel type: Diesel

 Body type: Wagon

 Number of cylinders: 5



Inspection Report Summary

To know how to read the report, please see the end of report.

 Engine Check points: 25 No Notes 



 Electricity system Check points: 15 Notes: 1



 Under the car Check points: 22 No Notes 



 Rear Axle & Drive Shaft Check points: 9 No Notes 


 Tyres Check points: 6 Notes: 3


 Exterior Check points: 29 Notes: 13

 Gearbox Check points: 11 No Notes 

 liquids Check points: 6 No Notes 

 Break System Check points: 15 No Notes 

 Interior Check points: 28 Notes: 6

 Additional Check points: 5 Notes: 1

Notes from Mechanic

Overall Inspection Summary:
The vehicle, considering its 2005 model year, is in good condition. The drive was smooth, with the cruise control and air conditioning functioning well. Minor cosmetic wear is present, including a few scratches consistent with age. Service documentation includes some repair receipts and a partial, though not complete, logbook history.

Inspector's Recommendation:
Based on the findings, it is advised to use this report to negotiate on the asking price and secure the best possible deal.



Engine

Check points: 25

Notes: 0

	OK	Note	N/A
Engine Overhaul	✓		
Front Crankshaft oil seal	✓		
Rear Crankshaft oil seal	✓		
Engine Tune-up			✓
Engine Mount	✓		
Oil pan gasket	✓		
Valve cover gasket	✓		
Oil filter housing o-ring	✓		
Intake manifold gasket	✓		
Radiator	✓		
Engine timing cover gasket	✓		
Water pump	✓		
Timing belt	✓		

	OK	Note	N/A
Fuel filter	✓		
Air filter	✓		
Engine sump	✓		
Intake manifold	✓		
Radiator hose	✓		
Pulley belt	✓		
Engine cover	✓		
Coolant reservoir	✓		
Steering pump	✓		
Windshield washer reservoir	✓		
Radiator and cap	✓		
Radiator coolant overflow	✓		
Engine bolt disassemble signs	✓		



Gyrex

Check points: 11

Note 0

	OK	Note	N/A
Oil pump gasket	✓		
Front Crankshaft oil seal	✓		
Rear Crankshaft oil seal	✓		
Transmission mount	✓		
Oil pan gasket	✓		
Gear stick sounta	✓		

	OK	Note	N/A
Oil Cooler Pipe	✓		
Gear performance	✓		
Transmission sump	✓		
Transmission intercooler	✓		
Transmission bolts	✓		



Electricity system

Check points: 15

Note 1

	OK	Note	N/A
Battery	✓		
Alternator	✓		
Starter operation/ starter motor	✓		
Lights	✓		
a/c compressor	✓		
Center lock	✓		
Windshield wipers blades	✓		
Car A/C screen	✓		

	OK	Note	N/A
Car error codes		●	
A/C condenser	✓		
A/C radiator	✓		
A/C filter	✓		
A/C hose	✓		
Rear A/C	✓		
Fuse box	✓		



liquids

Check points: 6 Notes: 0

	OK	Note	N/A
Engine oil	✓		
Transmission oil	✓		
Brake fluid	✓		

	OK	Note	N/A
Engine coolant	✓		
Windshield Fluid	✓		
Steering Fluid	✓		



Under the car

Check points: 22 Notes: 0

	OK	Note	N/A
Idler arm	✓		
Steering hoses	✓		
Steering box	✓		
Rack and pinion steering	✓		
Rear shock absorbers	✓		
Front shock absorbers	✓		
Upper arm bushing	✓		
Rear lower arm bushing	✓		
Suspension spring	✓		
Stabilizer link rubber	✓		
Stabilizer link	✓		

	OK	Note	N/A
Cross member sub assy	✓		
Inner tyre rod end	✓		
Outer tyre rod end	✓		
Ball joint right	✓		
Ball joint left	✓		
Top strut mount	✓		
Front stabilizer linkage	✓		
Rear stabilizer linkage	✓		
Rust	✓		
exhaust	✓		
Under the vehicle	✓		



Break System

Check points: 15 Notes: 0

	OK	Note	N/A
Brake master CLY	✓		
Vacuum brake booster	✓		
Brake hoses	✓		
Brake pad front	✓		
Brake pad rear	✓		
Front brake disc rotor	✓		
Rear brake disc rotor	✓		
Wheel bearing front	✓		

	OK	Note	N/A
Wheel bearing rear	✓		
Wheel bearing front rear	✓		
Brake wheel cylinder front left	✓		
Brake wheel cylinder front right	✓		
Brake wheel cylinder rear left	✓		
Brake wheel cylinder rear right	✓		
Hand brake cable	✓		



Rear Axle and Drive Sheft

Check points: 9 Notes: 0

	OK	Note	N/A
Front axle	✓		
Axle difference	✓		
Difference	✓		
Axle seal front	✓		
Axle seal rear	✓		

	OK	Note	N/A
Propeller shaft/Drive shaft	✓		
Front flange	✓		
Rear flange	✓		
4WD	✓		



Interior

Check points: 28

Notes: 6

	OK	Note	N/A
Control panel Switch	✓		
Lock button	✓		
Accessories	✓		
Mirror control switch	✓		
Dashboard	✓		
Drive wheel buttons			✓
Display	✓		
Drive wheel	✓		
Speakers	✓		
Roof	✓		
Air condition vents	✓		
A/C control	✓		
Sun Roof			✓
Sun visors left	✓		
Sun visor right			
Left front seat	✓		

	OK	Note	N/A
Right front seat			
Back mattresses			
Roof mat	✓		
Right front door decoration	✓		
Front door left decoration			
Back door right decoration			
Back door left decoration			
The left front window button	✓		
The left rear window button	✓		
The right rear glass button	✓		
The left rear glass button	✓		
Gear shift	✓		
Cup holder	✓		
Trunk opening button	✓		
Hood button	✓		



Additional

Check points: 5

Notes: 1

	OK	Note	N/A
Console	✓		
Folding mirrors			✓
Tool bag			✓
Crane			✓
Safety triangle			✓
Camera	✓		
Cruise control	✓		
Preserving the path (Radar)			✓
Auto park			✓
Back curtains			

	OK	Note	N/A
Back screens	✓		
Lipper doors			✓
Rear brake assist			✓
Front brake assist			✓
Remote engine start			✓
4W button			✓
Hood suspension			✓
Wheels			✓
Tyre sensors			✓



Tyres

Check points: 6

Notes: 3

	OK	Note	N/A
Front right tyre			
Front left tyre			
Rear right tyre			

	OK	Note	N/A
Rear left tyre	✓		
Spare tyre	✓		
Same Brand, Size, Style	✓		



Exterior

Check points: 29

Notes: 13


	OK	Note	N/A
Front Section (Overall)		●	
Front bumper condition		●	
Headlights & indicators	✓		
Bonnet condition		●	
Front grill(s)	✓		
Front windscreen (chips, cracks, seals)	✓		
Left Side (Overall)	✓		
Front left door		●	
Rear left door	✓		
Left front fender	✓		
Left rear fender		●	
Side mirror (left)	✓		
Door pillar / structural alignment (left)	✓		
Right Side (Overall)	✓		
Front right door		●	
Rear right door		●	

	OK	Note	N/A
Right front fender		●	
Right rear fender		●	
Side mirror (right)	✓		
Door pillar / structural alignment (right)	✓		
Back Side (Overall)		●	
Rear bumper		●	
Boot / tailgate condition		●	
Rear windscreen (glass & seals)	✓		
Tail lights	✓		
Rear garnish / trims	✓		
Roof (Overall)	✓		
Roof condition (paint, dents, scratches, rust)		●	
Roof accessories (if any, e.g. rails, sunroof condition, seals)	✓		

List of Notes (Issues Found)

Electrical system **Note:** 1

Car error codes photo

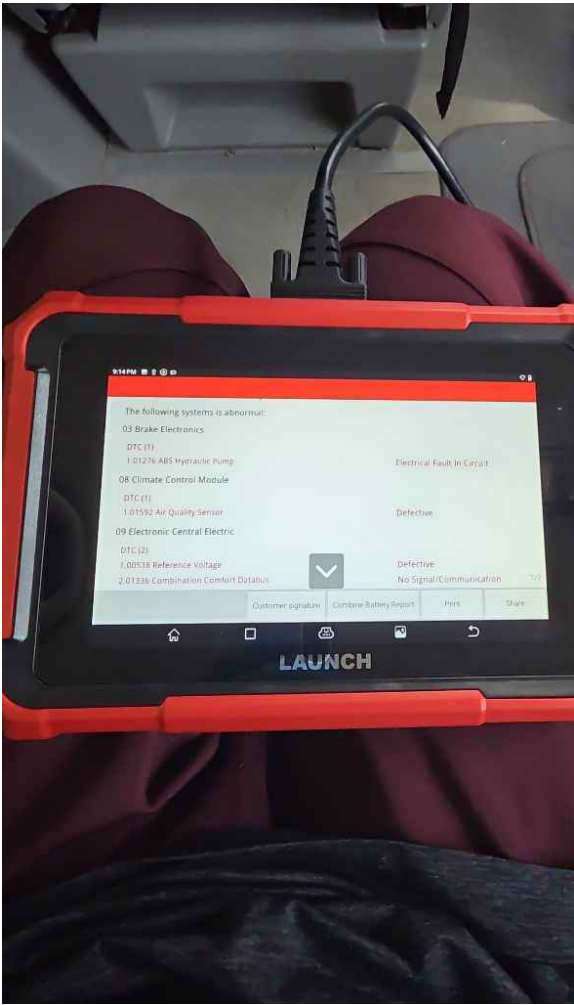

Car error codes note

few minor codes.

Interior **Interior
No of
Notes** 6

Sun visor right photo



Sun visor right note

light is not working.

Right front seat photo



Right front seat note

after market seat cover. original seat is good.hand rest is broken.

Back mattresses photo



Back mattresses note

this seat has been replaced.

Front door left decoration photo



Front door left decoration note

Back door right decoration photo



Back door right decoration note

decor is broken.

Back door left decoration photo



Back door left decoration note

decor cloth

Additional

Note:

1

Back curtains photo



Back curtains note

side door curtains.

Tyre

Note: 3


Front right tyre photo



Front right tyre note

tyre is good. few scratches on rims.

Front left tyre photo

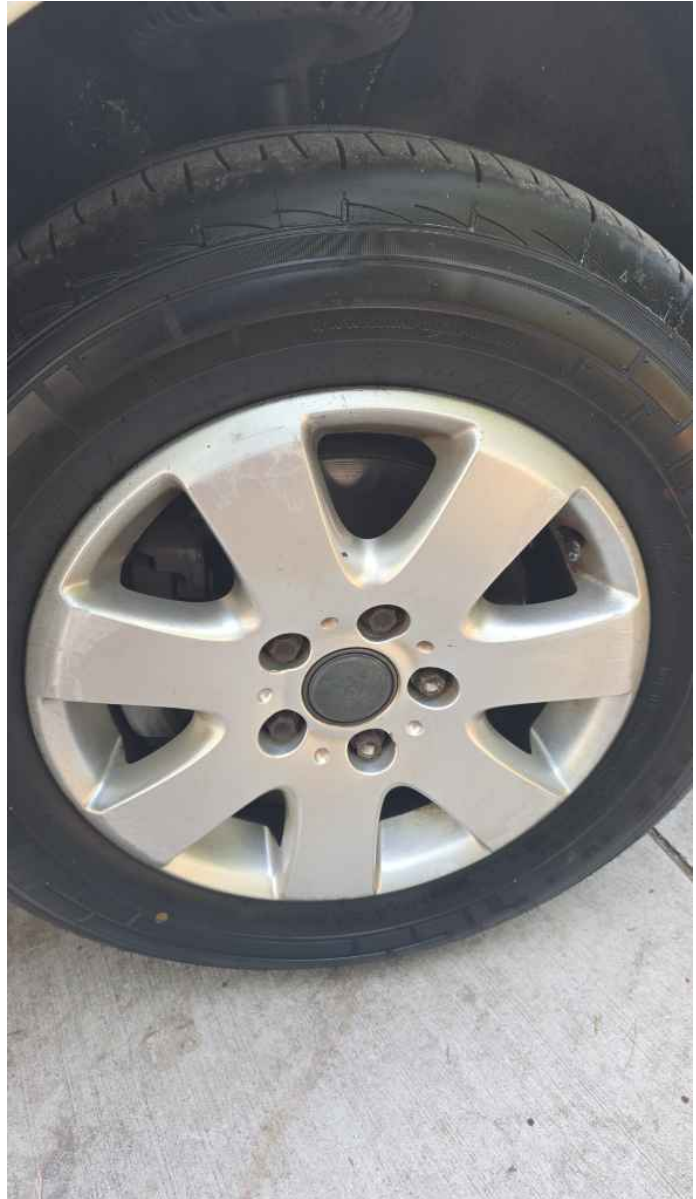

Front left tyre note

scratches on rims

Rear right tyre photo



Rear right tyre note

few scratches on rim

Exterior

Note:

13

Front Section (Overall) photo



Front Section (Overall) note

few scratches on bumper. otherwise good

Front bumper condition photo



Front bumper condition note

scratches on both side minor.

Bonnet condition photo



Bonnet condition note

scratch at the corner on passenger side.

Front left door photo



Front left door note

scratch minor

Left rear fender photo



Left rear fender note

minor scratch

Front right door photo



Front right door note

big scratch on front door


Rear right door photo



Rear right door note

scratches and few chip marks

Right front fender photo

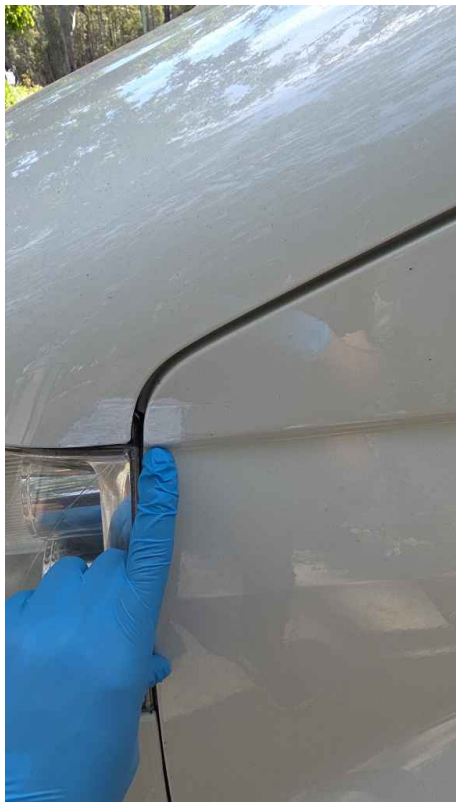

Right front fender note

scratch

Right rear fender photo



Right rear fender note

this body part has been repaired and painted again. still have few minor scratches

Back Side (Overall) photo



Back Side (Overall) note

back door has been repaired and repainted again. inside decor is not fitted properly. still attached with tape.

Rear bumper photo



Rear bumper note

few scratches

Boot / tailgate condition photo



Boot / tailgate condition note

boot gate doesn't close properly.

Roof condition (paint, dents, scratches, rust)
photo








Roof condition (paint, dents, scratches, rust)
note

need to wash properly

Exterior Photos




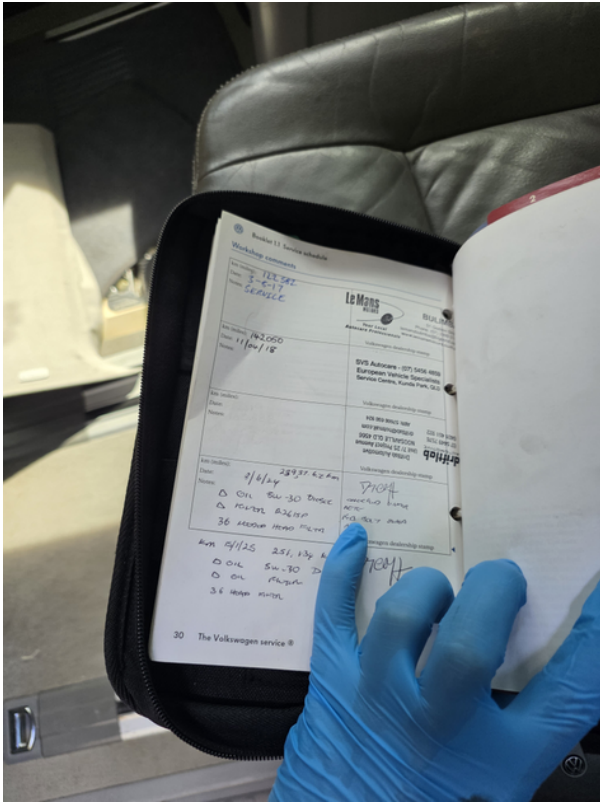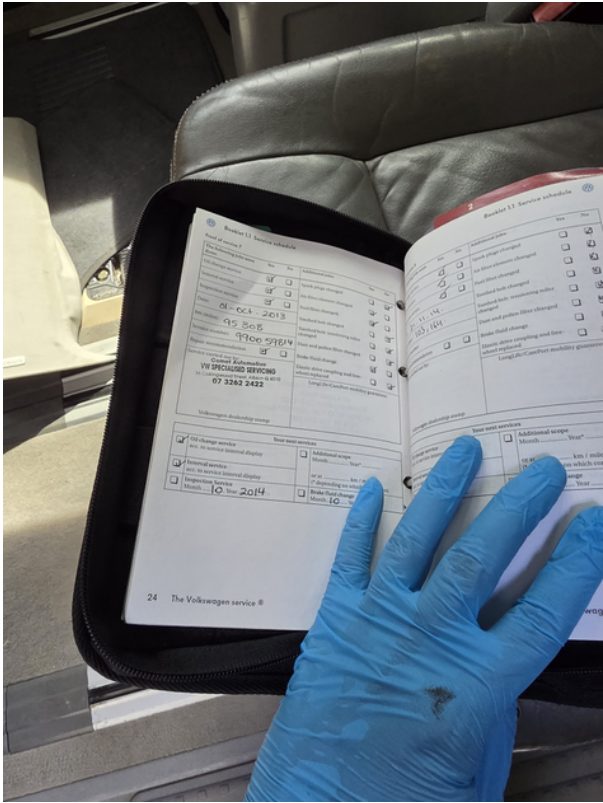


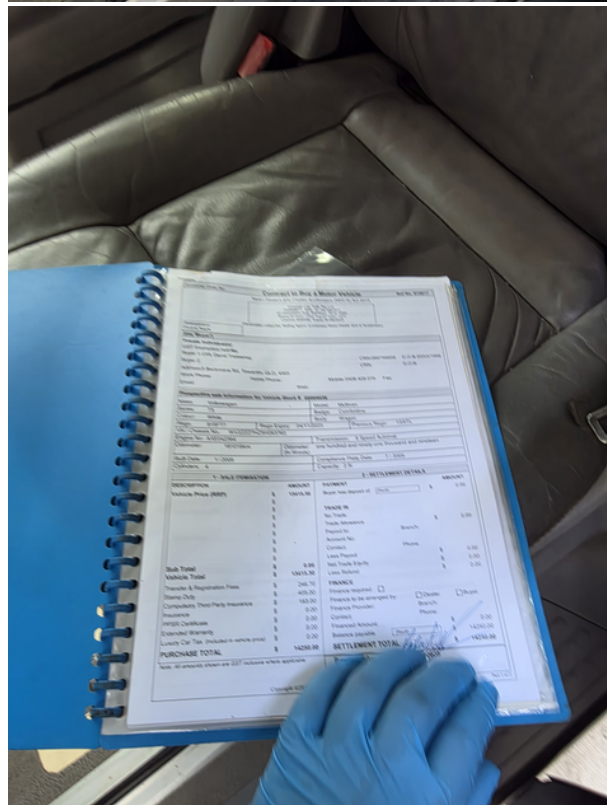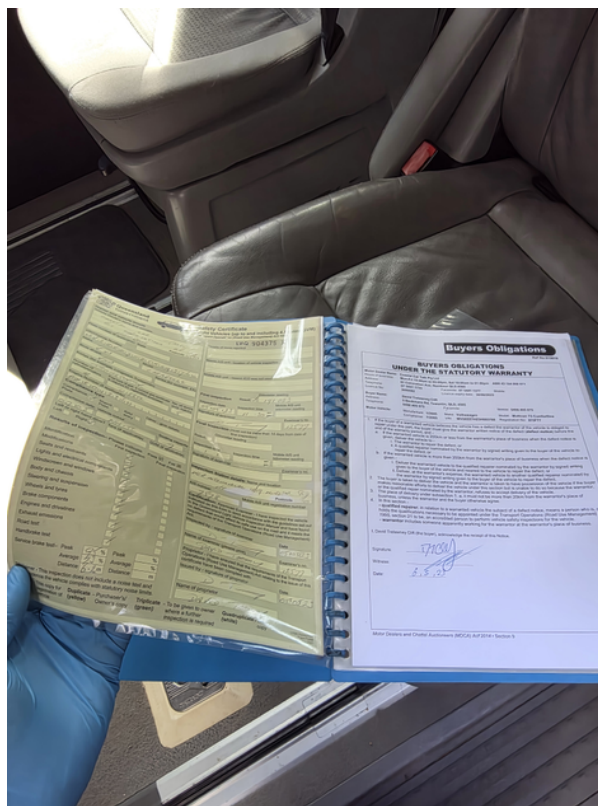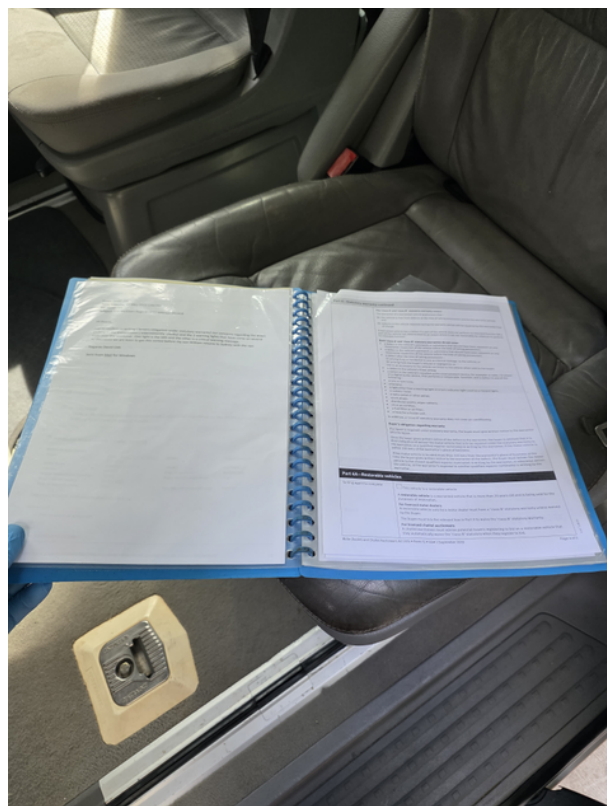

Exterior Photos



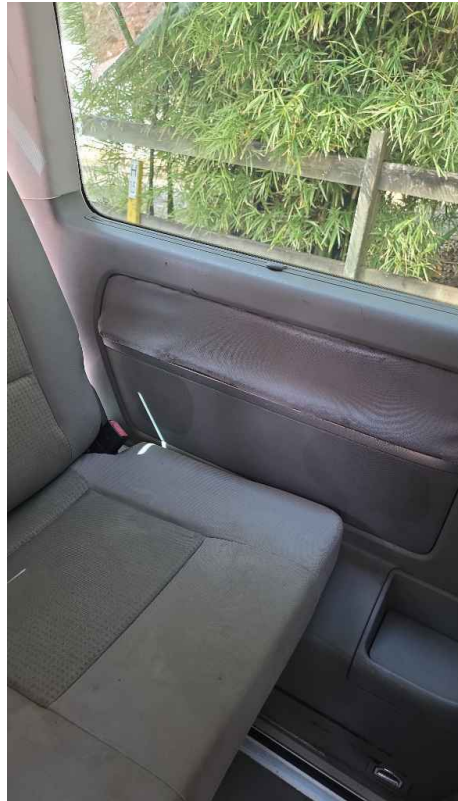

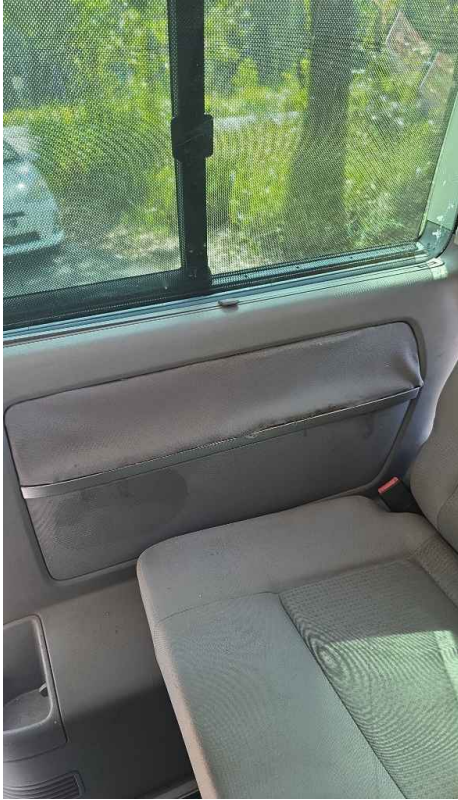

How to read the inspection report

The inspection is carried out by a specialized car inspector from a car company, where the inspector inspects the car in several stages:

All checkpoints have more than one status:

1. **Body:** The inspector inspects all parts of the body and identifies damage to each part of the car, such as: the front fender, the rear, Windscreen, Windows, Bumpers, and Mirrors.
2. **Electrical system:** This involves checking the car's electrical parts and ensuring they are working properly, such as: the battery and the wiring.
3. **Car mechanics:** It is divided into several main sections, which are:
 - * **Engine:** Checking the parts related to the engine's operation, such as the air filter and engine cover. Gearbox: Checking the proper operation of the car's transmission mechanism, such as the gear cooler and gearbox face.
 - * **Brake system:** It includes the basic points of the brake system, such as: rear hub, front brakes.
 - * **Differential and Corona:** It is the part responsible for the balance and stability of the car, including the supports, such as: the propeller shaft, and the front reverse.
 - * **Under the car:** Parts and components located under the car that can only be accessed from under the car, such as: chassis arm, stabilizer bar.
 - * **Fluids:** Check the condition of essential fluids in the car, such as: engine oil, gearbox oil.
4. **Interior:** Check the car's interior for damageable parts and decorations, such as: window controls and steering wheel.

All checkpoints have more than one status:

1. **In good condition:** This means that the point has been checked and is working well or has no apparent damage.
2. **Note:** This means that there is damage or it is not working properly. A picture of each note is attached at the end of the report.

Disclaimer

This inspection is intended solely to "assess" the condition of the vehicle at the time and date of the inspection. Specifically, the car company does not assume any liability for any loss or damage arising in connection with the ownership or operation of the vehicle, nor are we responsible for any hidden faults or tampered with components that are not readily apparent. The vehicle components were visually inspected in the condition reported and listed in the report at the time of inspection only. We are not responsible for any damage or defects not found during this inspection. Other malfunctions may exist that did not occur or become apparent during the inspection. This report is for informational purposes only and is not considered a recommendation for or against the purchase of the inspected vehicle.

Vehicle Diagnostic Report

The Report is created by **LAUNCH X-431**

Vehicle Information

Year:2005
Make:VW_CV
VIN:WV2ZZZ7HZ5H093760
Vehicle Software Version:V29.10
Diagnostic Application Version:V8.00.029
Diagnostic path:Status Report



Repair Shop

Shop Name:
Address:
Zip Code:
Telephone:
Email:
SN:987940058893
Test Time:2025-09-26 21:09:43



System fault code 【Pre-Repair】

The following systems is abnormal:

03 Brake Electronics

DTC (1)

1.01276 ABS Hydraulic Pump

Electrical Fault In Circuit

08 Climate Control Module

DTC (1)

1.01592 Air Quality Sensor

Defective

09 Electronic Central Electric

DTC (2)

1.00538 Reference Voltage

Defective

2.01336 Combination Comfort Databus

No Signal/Communication

18 Auxiliary/Parking Heating

DTC (2)

1.00664 Fuel Gauge

Lower Limit Exceeded

2.01341 Control Module In Instrument Cluster At Comfort CAN

No Signal/Communication

76 Parking Aid

DTC (1)

1.01543 Parking Aid Warning Buzzer

Open Circuit/Short Circuit To Ground

The following systems are OK:

- 1.01 Engine Electronics
- 2.02 Transmission Electronics
- 3.15 Airbag
- 4.17 Instrument Cluster
- 5.19 Data Bus OBD Interface
- 6.25 Anti-Theft Immobilizer
- 7.46 Comfort System Central Control Module

Disclaimer

This test report is for reference only for vehicle test and maintenance. The vehicle operating data provided in this report are all static data. The detailed dynamic diagnostic data can be read by professional maintenance device, and LAUNCH will not be liable for any accidents and failures arising therefrom!

CarHistory Report & PPSR Certificate

Report generated on 27/09/2025

REPORT ID
14192795

VIN	WV2ZZZ7HZ5H093760
Make	VOLKSWAGEN
Model	MULTIVAN
Variant/series	COMFORTLINET5
Body	4D VAN
Transmission	6 SP AUTOMATIC TIPTR
Year (first retail date)	2005
Colour	WHITE



*Picture provided is a sample only

QUICK SUMMARY



No stolen status
reported



No written-off
status reported



No financial
interests reported



Possible odometer
rollback



Vehicle registered

VEHICLE DETAILS

✔ Vehicle registered

VEHICLE REGISTRATION

Registration plate	815FT7
Registration state	QLD
Registration expiry date	04-11-2025

FIRST SALE INFORMATION

First sale date	15-07-2005
Postcode of first sale	4670
First buyer type	PRIVATE

ENGINE DETAILS

Engine number	Refer to PPSR Certificate
Engine size	2.5L
Cylinders/rotors	DT5
Fuel type	DIESEL
Power (KW)	128
Torque (Nm)	400

VEHICLE RATINGS

ANCAP safety rating	-
Overall green rating	-
Air pollution rating	-
Greenhouse rating	-



CarHistory notes:

Vehicle registration information is sourced via the PPSR. Refer to the PPSR Certificate below.

REPORTED ODOMETER HISTORY

⚠ Possible odometer rollback

LAST REPORTED ODOMETER READING

Kilometres	180,908
Date reported	17/03/2021


READING ENTERED BY YOU

Kilometres	258,664
Date reported	27/09/2025

The odometer history for this vehicle has been supplied to CarHistory by various sources within the automotive industry.

Kilometres	Date reported	Alerts
258,664	27/09/2025	
180,908	17/03/2021	
11,111	20/11/2020	Possible Odometer Rollback
176,797	06/12/2019	

176,297	15/08/2019	
176,296	12/08/2019	

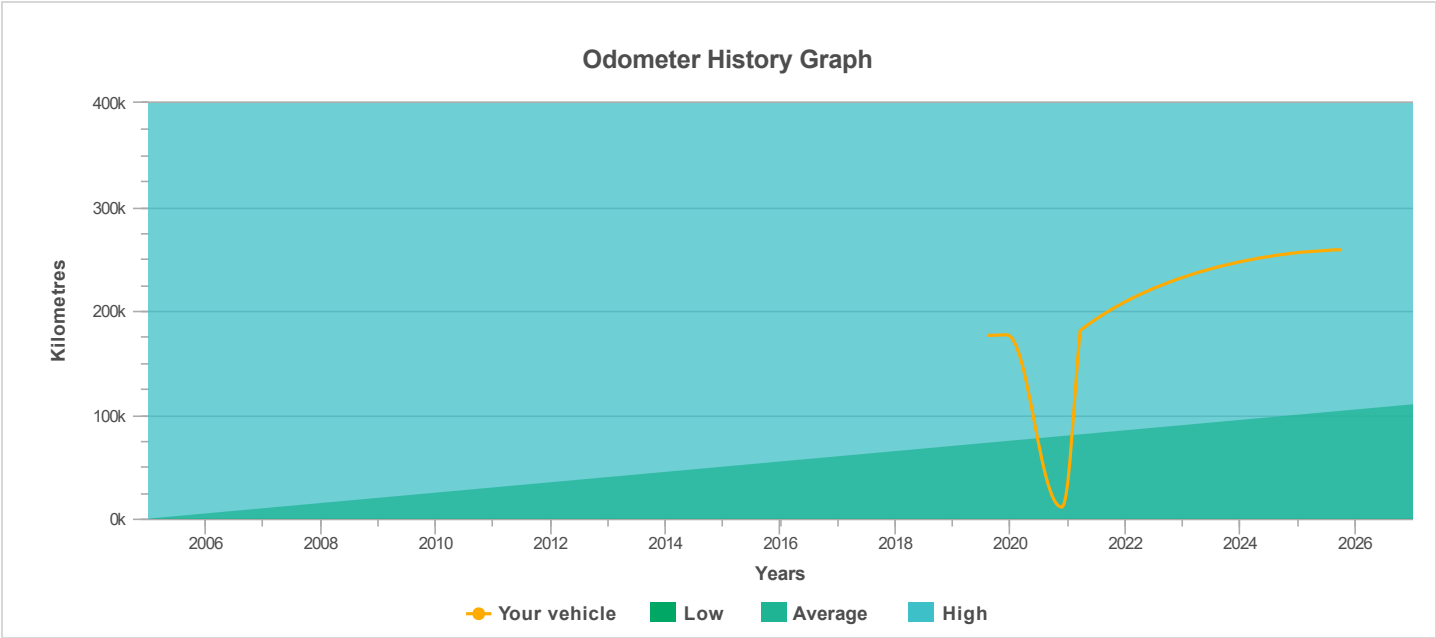

CarHistory notes:

CarHistory relies on data received from third parties. We recommend you review the vehicle's log book and service history to determine the accuracy of the vehicle's odometer reading.

REPORTED SALES LISTINGS

No known sales listings for this vehicle.

CarHistory notes:

Reported sales listings are sales advertisements derived from various ecommerce sites and provide an indication of how often the vehicle has been listed for sale.

VALUATION

Valuation information sourced from Glass's Guide.


Dealer trade price	Dealer retail price	Private sale price
\$ 5,500.00 - \$ 6,500.00	\$ 8,510.00 - \$ 10,120.00	\$ 7,150.00 - \$ 8,130.00

CarHistory notes:

Valuation information is intended as a guide to the current market value of the vehicle. It is recommended you have a full and detailed independent vehicle inspection completed prior to purchase.


PRICE COMPARISON

The vehicle price is less than the majority of vehicles.

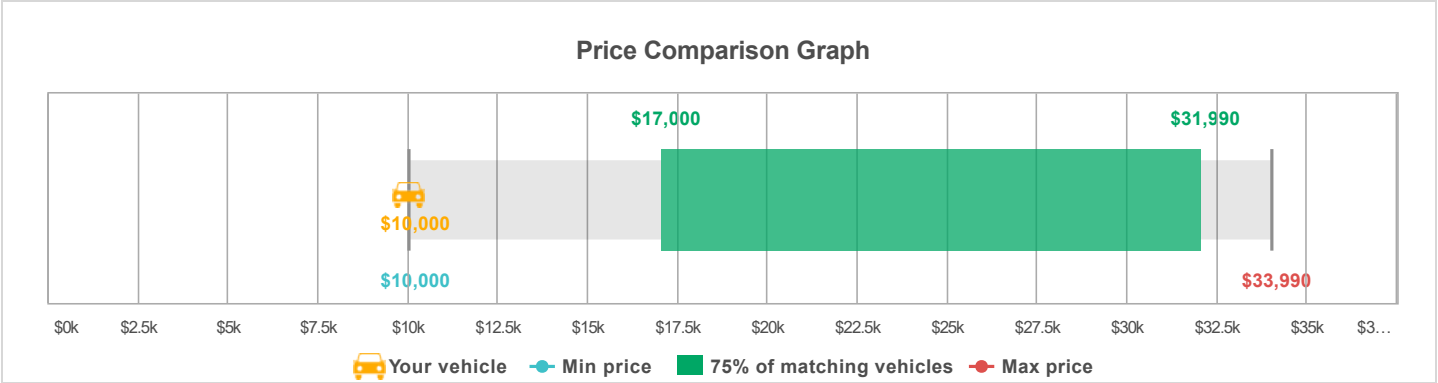

ODOMETER COMPARISON

The odometer reading is higher than the majority of vehicles.

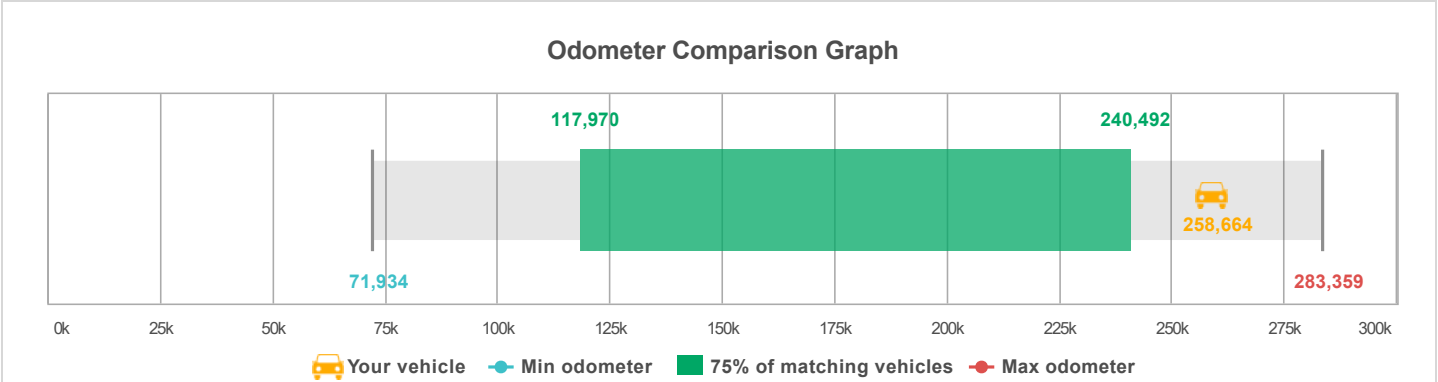

SIMILAR SALES

Details of similar vehicles recently on the market.

Make	Model	Variant	Year	Odometer	Odometer date	Price	Date
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	181,000	03-2021	\$21,300.00	03-2021
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	141,000	09-2019	\$13,300.00	09-2019
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	240,000	03-2019	\$10,000.00	01-2016
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	264,000	08-2017	\$19,990.00	03-2013
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	283,000	11-2023	\$28,990.00	01-2013
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	265,000	12-2015	\$24,740.00	01-2013
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	176,000	12-2011	\$17,000.00	06-2011
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2005	185,000	12-2014	\$28,888.00	04-2011

VOLKSWAGEN	MULTIVAN	COMFORTLINE	2006	231,000	02-2023	\$14,892.00	06-2017
VOLKSWAGEN	MULTIVAN	COMFORTLINE	2006	158,000	08-2014	\$18,888.00	08-2014

VEHICLE EQUIPMENT/OPTIONS

Standard equipment/options included with this vehicle.

17 Inch Alloy Wheels	Air Conditioning	Anti-lock Braking
Brake Assist	Central Locking Remote Control	Cruise Control
Dual Airbag Package	Electronic Differential Lock	Electronic Stability Program
Engine Immobiliser	Head Airbags	Heated Front Seats
Power Mirrors	Power Steering	Power Windows
Radio CD with 8 Speakers	Seat belt Pre-tensioner	Side Front Air Bags
Traction Control System	Trip Computer	

FINANCE CHECK

✔ No financial interests reported

PPSR has reported that this vehicle is not encumbered.



CarHistory notes:

Financial encumbrance information is sourced via the PPSR. Refer to the PPSR Certificate below.

WRITTEN-OFF CHECK

✔ No written-off status reported

PPSR has reported that this vehicle has not been written-off.



CarHistory notes:

Written-off information is sourced via the PPSR. Refer to the PPSR Certificate below.

WARNING: We have no control over when third parties choose to report information or events and in some cases there may be a delay between when an event occurs and when that information is recorded, including via the National Exchange of Vehicle and Driver Information System (NEVDIS) or on the Personal Property Securities Register (PPSR).

STOLEN CHECK

No stolen status reported

PPSR has reported that this vehicle is not stolen.



CarHistory notes:

Stolen information is sourced via the PPSR. Refer to the PPSR Certificate below.

WARNING: We have no control over when third parties choose to report information or events and in some cases there may be a delay between when an event occurs and when that information is recorded, including via the National Exchange of Vehicle and Driver Information System (NEVDIS) or on the Personal Property Securities Register (PPSR).

ACCESS YOUR REPORT ONLINE

A copy of your report can be accessed for up to 90 days via the [Customer Login](#).

To allow an individual to view this report online, simply provide them with the following link:

<https://secure.carhistory.com.au/vcn?vcn=A5-MGHB>

NEED HELP WITH READING THE REPORT?

Visit our website for frequently asked questions and a glossary to help you better understand your report.

[CarHistory.com.au/FAQs](https://www.carhistory.com.au/FAQs)

[CarHistory.com.au/Glossary](https://www.carhistory.com.au/Glossary)

GENERAL DISCLAIMERS

This report has been supplied on the [Terms and Conditions](#) set out on the CarHistory website, and accepted by you before you purchased this report.

The data used to compile this report has been sourced from various independent and Government sources, as a result CarHistory can accept no responsibility for the accuracy or completeness of information.

PPSR CERTIFICATE

The following certificate has been issued by the Australian Financial Security Authority.

To help you better understand the details of your PPSR Certificate, a glossary of terms, and information on how to read the PPSR Certificate is available on the CarHistory website.

[CarHistory.com.au/PPSR-Help](https://www.carhistory.com.au/PPSR-Help)



27/09/2025

Serial Number Search Certificate

This is a serial number search certificate for a serial number search

This Search certificate is provided under section 174 of the *Personal Property Securities Act 2009*

Search certificate number: 8148481204730001

Search number: 814848120473

This search certificate reflects the data contained in the PPSR at 27/09/2025 13:55:53 (Canberra Time).

Search Criteria Details

Serial number search type: VIN
Motor vehicle: WV2ZZZ7HZ5H093760
PPSR registration state searched: Current

PPSR Registration Details

There is no security interest or other registration kind registered on the PPSR against the serial number in the search criteria details.

Additional Motor Vehicle Details – NEVDIS

Identifier number:	WV2ZZZ7HZ5H093760	Identifier type:	VIN
Vehicle type:	CAR / SMALL PASSENGER VEHICLE	Make:	VOLKSWAGEN
Body type:	STATION WAGON	Model:	CARAVELLE
Colour:	WHITE	Engine number:	AXE042364
Registration plate number:	815FT7	State vehicle registered:	QLD
Registration expiry:	04 Nov 2025		
Year of manufacture:	2005	Year/Month of compliance:	2005-07

Important NEVDIS notifications about the Vehicle

Written-off:

- Not recorded as written-off.

Stolen:

- Not recorded as stolen.

Tasmanian stolen vehicle information is currently unavailable from this service. For information about the status of Tasmanian vehicles, go to:

<https://www.transport.tas.gov.au/MRSWebInterface/public/regoLookup/registrationLookup.jsf> (Note: you will need to provide the vehicle registration plate number to search this site).

A stolen vehicle notification, or the absence of one, does not necessarily mean a vehicle is or is not stolen.

If there is a stolen vehicle notification you wish to enquire about, you should contact the police force in the State or Territory indicated immediately after the date in the notification. The reference number at the end of the notification should be quoted as a part of your enquiry.

Please note that there may be multiple stolen notifications shown. A stolen notification can be for a VIN, Plate, Chassis and/or Engine.

Vehicle information is requested from Austroads NEVDIS database for each transaction involving a vehicle VIN or Chassis Number on the PPSR. The data is not part of interests registered on the PPSR and it is presented without any guarantee regarding its accuracy.

The NEVDIS data is intended to assist users with checking that the VIN or Chassis Number they entered, along with information they have about the vehicle from other sources, is accurate and to provide users with any data held on NEVDIS about a vehicle's stolen or written off status.

State and territory road agencies are the main source of NEVDIS data and the primary point of contact for enquiries, errors, and corrections.

Access to and use of data provided through the PPSR is subject to the PPSR General Conditions of Use and applicable third party data conditions (which can be obtained at www.ppsr.gov.au). To the extent permitted by law, all data provided through the PPSR is made available without any representation or warranty of any kind (without limitation in respect to accuracy) and the Commonwealth, and our third party data providers (which includes any person mentioned in the Third Party Data Conditions as providing information through the PPSR), have no liability to you in respect of any loss or damage that you might suffer no matter how arising (including negligence) that is directly or indirectly related to the NEVDIS Data.

How to verify this certificate on the PPSR

You can use the search number from an original search (as shown on this certificate) to retrieve the original search results and to issue a copy of the search certificate at <https://transact.ppsr.gov.au/ppsr/Home>. There is no fee, however this process will not provide any update to the information in the original search.

Privacy and Terms and Conditions

The Australian Financial Security Authority is subject to the *Privacy Act 1988* which requires that we comply with the Australian Privacy Principles (APPs) set out in the Act. The APPs set out how Australian Government agencies should collect, use, store and disclose personal information and how individuals can access records containing their personal information.

Access to and use of the PPSR is subject to the General Conditions of Use, as well as other relevant terms and conditions. All relevant terms and conditions can be found at www.ppsr.gov.au.

End of search certificate

EMAIL: enquiries@ppsr.gov.au WEBSITE: www.ppsr.gov.au

GPO Box 1944 Adelaide SA 5001

1300 00 77 77